



OHV Sprocket Shaft



Left Crankcase Bearing by Timken. Factory assembled with correct spacer for proper end play.

VT No.	OEM	Fits	Model
12-0310	9029	1955-68	Big Twin
12-0309	9028	1969-up	Big Twin

1970-up Sprocket Shaft Spacer and Seal Kit.
VT No. 10-8284






Sprocket Shaft Key. Sold in 10 pk.
VT No. OEM Fits
12-0200 23985-12 1930-55 BT
12-0203 23985-56 1956-80 BT



Nut, Sprocket Shaft Taper End.
Eastern Jims OEM Fits
12-0532 12-0612 24023-36 1936-71 BT
(5 pk) (Each)
12-0534 12-0610 24017-80 1972-85 BT Pair




Lock Plate, Sprocket Shaft. Sold in 10 pk.
VT No. Fits
17-0913 1936-71
17-0917 1972-81

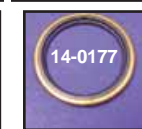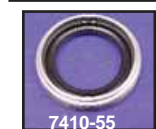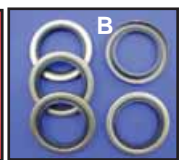

BT Left Side Engine Case Seals.

VT No.	#	OEM	Year	Model
7411-2	A	24776-40	1936-54	61-74-80
14-0965		24031-55	1955-68	OE type
7410-55	C	24031-55	1955-68	VT
7410-1	C	24031-55	1955-68	Colony
7410-1-OS		Oversize	1955-68	Colony (+.002)
7410-1-US		Undersize	1955-68	Colony (-.002)
14-0177		Seal only	For above	
14-0185	B	24031-69	1969 only	BT
14-0108	B	12026B	1970-99	74 & 80 BT, 5 pk.

Note: 7410-1, 7410-55 area screw-in insert with integral seal. 14-0965 is stock type screw-in without seal. 7411-2, 8211-2 both include seal, spacer & snap ring.



Big Twin Sprocket Shafts fit as listed machined and hardened to factory specifications.

Model	Year	OEM	Jims	Eastern	Replica
61 & 74	1930-54	24001-30	10-8314	10-0410	10-0469
74	1955	24001-55	—	10-0411	—
74	1956-64	24001-56	10-8362	10-0412	—
74	1965-69	24001-65	10-8315	10-0413	—
74	1970-71	24001-70	10-8322	10-0414	—
74 & 80	1972-E81	24001-72	10-8316	10-0415	10-0876
80	L1981-86	23909-80	10-8318	10-0416	10-0440
80	L1981-85	.250 longer	10-8368	—	—
80	L1981-85	.750 longer	10-8369	—	—

Special to install pre1981 80" Flywheels in 1956-64 BT **10-0418**
Special to install pre1981 80" Flywheels in 1965-69 BT **10-0419**
Special to install 1981-85 80" Flywheels in 1956-64 BT **10-0435**
Special to install 1981-85 80" Flywheels in 1965-69 BT **10-0436**

V-Twin is an Original "Jims" Distributor since 1977!

Sprocket Shaft Spacers fit between Timken bearing assembly & engine sprocket, and are 'sealed' by late engine seal VT No. 14-0108.


VT No.	OEM	Years	Model
10-8269*	.335 Long	1955-64	BT
10-8270*	.666 Long	1965-69	BT
14-0108	12026B	Seal only	5 pk



*Special spacers to fit in 14-0108 seal when used on STD case sets.




Motor Shaft Spacer features built in seal flange to give added support for alternator rotor.
VT No. 10-0948

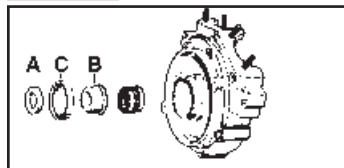

Sprocket Shaft Spacers fit Big Twins left side thru seal.



VT No.	#	OEM	Year	Length	U/M
7410-1	C	24031-55	1955-69	Seal Ea	
14-0108	C	12026B	1970-99	Seal 5	pk
10-1160	A	24029-55	1955-64	.336	
10-2509	A	24029-65	1965	.621	
10-2513	A	24032-66	1966-69	.516	
Set	A	24033-66	1966-69	.546	
of	A	24034-66	1966-69	.576	
6	A	24035-66	1966-69	.606	
	A	24036-66	1966-69	.636	
	A	24037-66	1966-69	.666	

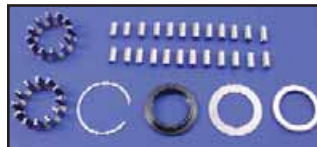

1941-54 Big Twin Left Sprocket Shaft Bearing & Hardware Kit includes loose rollers, cages and end slinger.
VT No. 12-0409



Left Bearing End Oil Slinger replaces 24776-40.
Fits 1940-54 BT.
VT No. 10-0429



1930-54 BT Motor Sprocket Nut Kit includes correct nut, key retaining ring & left bearing oil slinger.
VT No. item
12-0620 Kit
12-0503 Nut only